

Navajo Abandoned Uranium Mine

Site Screen Report

This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.

The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.

Mine Name: Charles Huskon No. 1
Mine ID: 124

Navajo AUM Western Region

Prepared by:

Weston Solutions, Inc.

Contract: W91238-06-F-0083

20074.063.017.0020

August 2011

Part I Site Identification, Location and Status**Site Names and ID numbers as applicable****Mine ID:** 124**Map ID:** W21**CERCLIS:** NNN000909211**Navajo Abandoned Mine Land Reclamation Program:** NA-0129**Local name / Aliases:** Charles Huskon #1; Huskon #1**Chapter and local area:** Coalmine Mesa**County:** Coconino **State:** Arizona**Lat/Long:** 35.879860252 N / -111.390328097 W**Nearby road and highway:** Indian Route 6730 **Local Post Office:** Cameron, AZ**Surface Land Status: check one or more and provide ownership and contact information below**

Tribal Trust Land	<input checked="" type="checkbox"/>	Public lands	<input type="checkbox"/>
Private	<input type="checkbox"/>	Tribal Fee Land	<input type="checkbox"/>
Bureau of Land Mgmt	<input type="checkbox"/>	Allotment	<input type="checkbox"/>
State	<input type="checkbox"/>	Fee land	<input type="checkbox"/>

Subsurface Mineral Rights:

No information on subsurface mineral rights ownership was found in the EPA/AUM Database.

Claim and operator information:

The mine surface land status is classified as Tribal Trust Land. Historical documents identified the operator of the mine as Arrowhead Uranium Company from 1952 to 1955, and Rare Metals Corporation of America from 1956 to 1961. No additional historical ownership / lease information was identified in the EPA / AUM database.

Number of residential structures within 200 feet of mine: None

Part II Summary of Radiological Readings

Mine ID: 124

Highest gamma radiation measurement: 164,291 counts per minute (cpm)

Background Average: 17,549 cpm


Two Times Background: 35,098 cpm

Describe any other radiological measurements:

A total of 4,730 gamma radiation measurements were collected from the mine site, ranging from 8,377 cpm to 164,291 cpm. Measurements collected in the vicinity of the reclamation area were found at a maximum level of approximately 160,000 cpm. The measurements are represented in Figures 1 and 2.

Distribution Chart and Statistics:

Site Gamma Radiation Statistics	
Number of Readings	4,730
Minimum (cpm)	8,377
Maximum (cpm)	164,291
Mean (cpm)	32,421
Median (cpm)	26,515
Standard Deviation	15,946

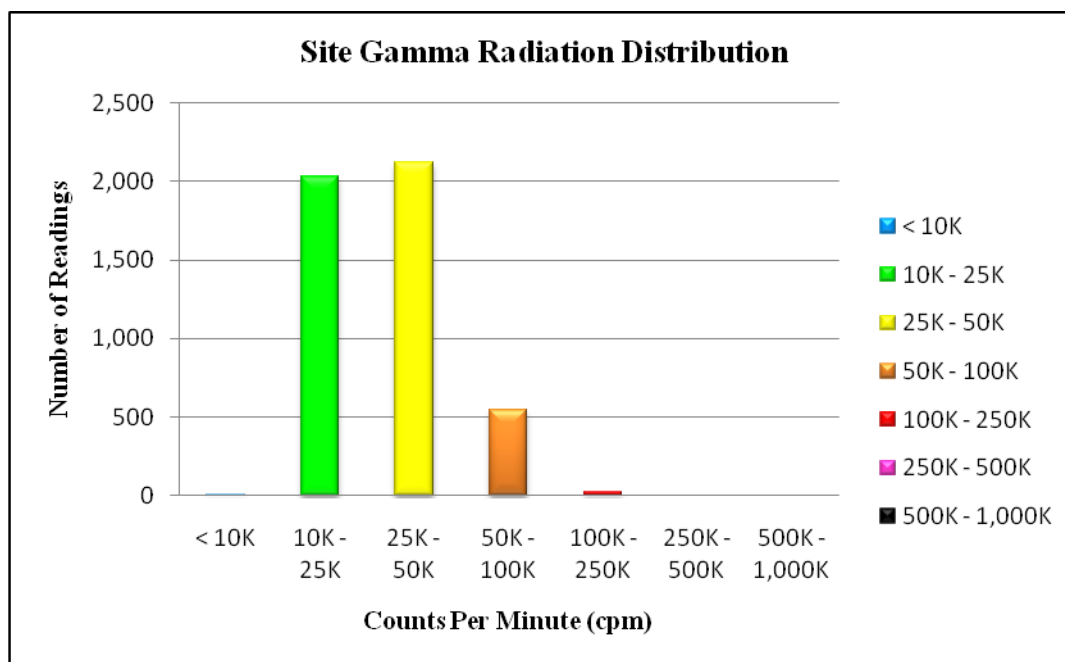

Part III Status of Reclamation and Mine Waste

Mine ID: 124

The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:

NAMLRP Status of the mine site: Reclaimed: Yes Waste Pile onsite: No

NAMLRP Project Number: NA-0129

NAMLRP Mine features: 1 Rim Strip / Pit

The following information was obtained from field observations collected during the 2011 site screening:

Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.

Observed reclamation work and status:

Adits:

None observed

Waste Piles:

None observed

Pits:

None observed

Shafts:

None observed

Other Debris and Mine Features:

2 reclamation caps: Cap 1 - former pit mine, large, multiple berms for erosion control, red-gray soil; Cap 2 - Possible former pit area, 100' diameter, semi-circle berm for erosion control, tan-gray soil

Part IV Site Observations and Environs**Observed Residential Structures (number and human habitation status of structures at the following distances from the mine site):**

0 to 200 feet: None observed

200 feet to 0.25 mile: None observed

Observed Public or Commercial Structures (schools, clinics, Chapter Houses, places of business and any other structures used by members of the community at the following distances from the mine site):

0 to 200 feet: None observed

200 feet to 0.25 mile: None observed

Levels measured around the perimeter(s) of the identified structure(s):

None

Observed Water Sources (number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine site):

0 to 0.25 miles: None observed

0.25 miles to 4 miles: Little Colorado River approximately 0.5 mi SW of site

Sensitive Environments (all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation):

None observed

Known Site History (information from interviews with Chapter officials and residents and database review, includes: mine ownership, type of mining operation, period of operation, known amount of production, and any other information provided):

The Charles Huskon No. 1 mine claim consists of an area of 97,570.75 m². The mine was identified as being operational from 1952 to 1961. While operational, the mine had a total reported production volume of 23,127 tons. The mine surface land status is classified as Tribal Trust Land. Historical documents identified the operator of the mine as Arrowhead Uranium Company from 1952 to 1955, and Rare Metals Corporation of America from 1956 to 1961. No additional historical ownership / lease information was identified in the EPA / AUM database.

Part V Response Action Summary

Summary of Evaluation Factors:

Accessibility:

Was the mine easily accessible to potential human activity?

Yes

Radiological Measurements:

Were any gamma radiation measurements collected at the mine greater than two times the site-specific background levels?

Yes

Waste Piles:

Were any unreclaimed waste piles observed at the mine with gamma radiation measurements greater than two times the site-specific background levels?

No

Structures:

Were any structures observed within 200 feet of the mine?

No

Potential Drinking Water Sources:

Were any potential drinking water sources observed within 4 miles of the mine?

Yes

Reclamation:

Was the mine reported to be previously reclaimed, or did the mine appear to be reclaimed?

Yes

Part VI Photos



Photo 1: Mine Site #124; Erosion control berms



Photo 2: Mine Site #124; Compromised erosion control berm



Photo 3: Mine Site #124



Photo 4: Mine Site #124; Drainage



Photo 5: Mine Site #124; Reclamation area

Part VII Contacts Reports and Information

Name: Eugene Esplain

Title or official role (if any): Navajo EPA Superfund Program

Telephone number: (928) 871-7331

Address: PO Box 2946, Window Rock, AZ 86515

Information provided: Lead Regulatory Agency

Name: _____

Title or official role (if any): _____

Telephone number: _____

Address: _____

Information provided: _____

Name: _____


Title or official role (if any): _____

Telephone number: _____

Address: _____

Information provided: _____

**Figure 1 - Gamma Radiation Measurements, Above Two Times Background
Charles Huskon No. 1 (124)
Coalmine Mesa Chapter, Navajo Nation**

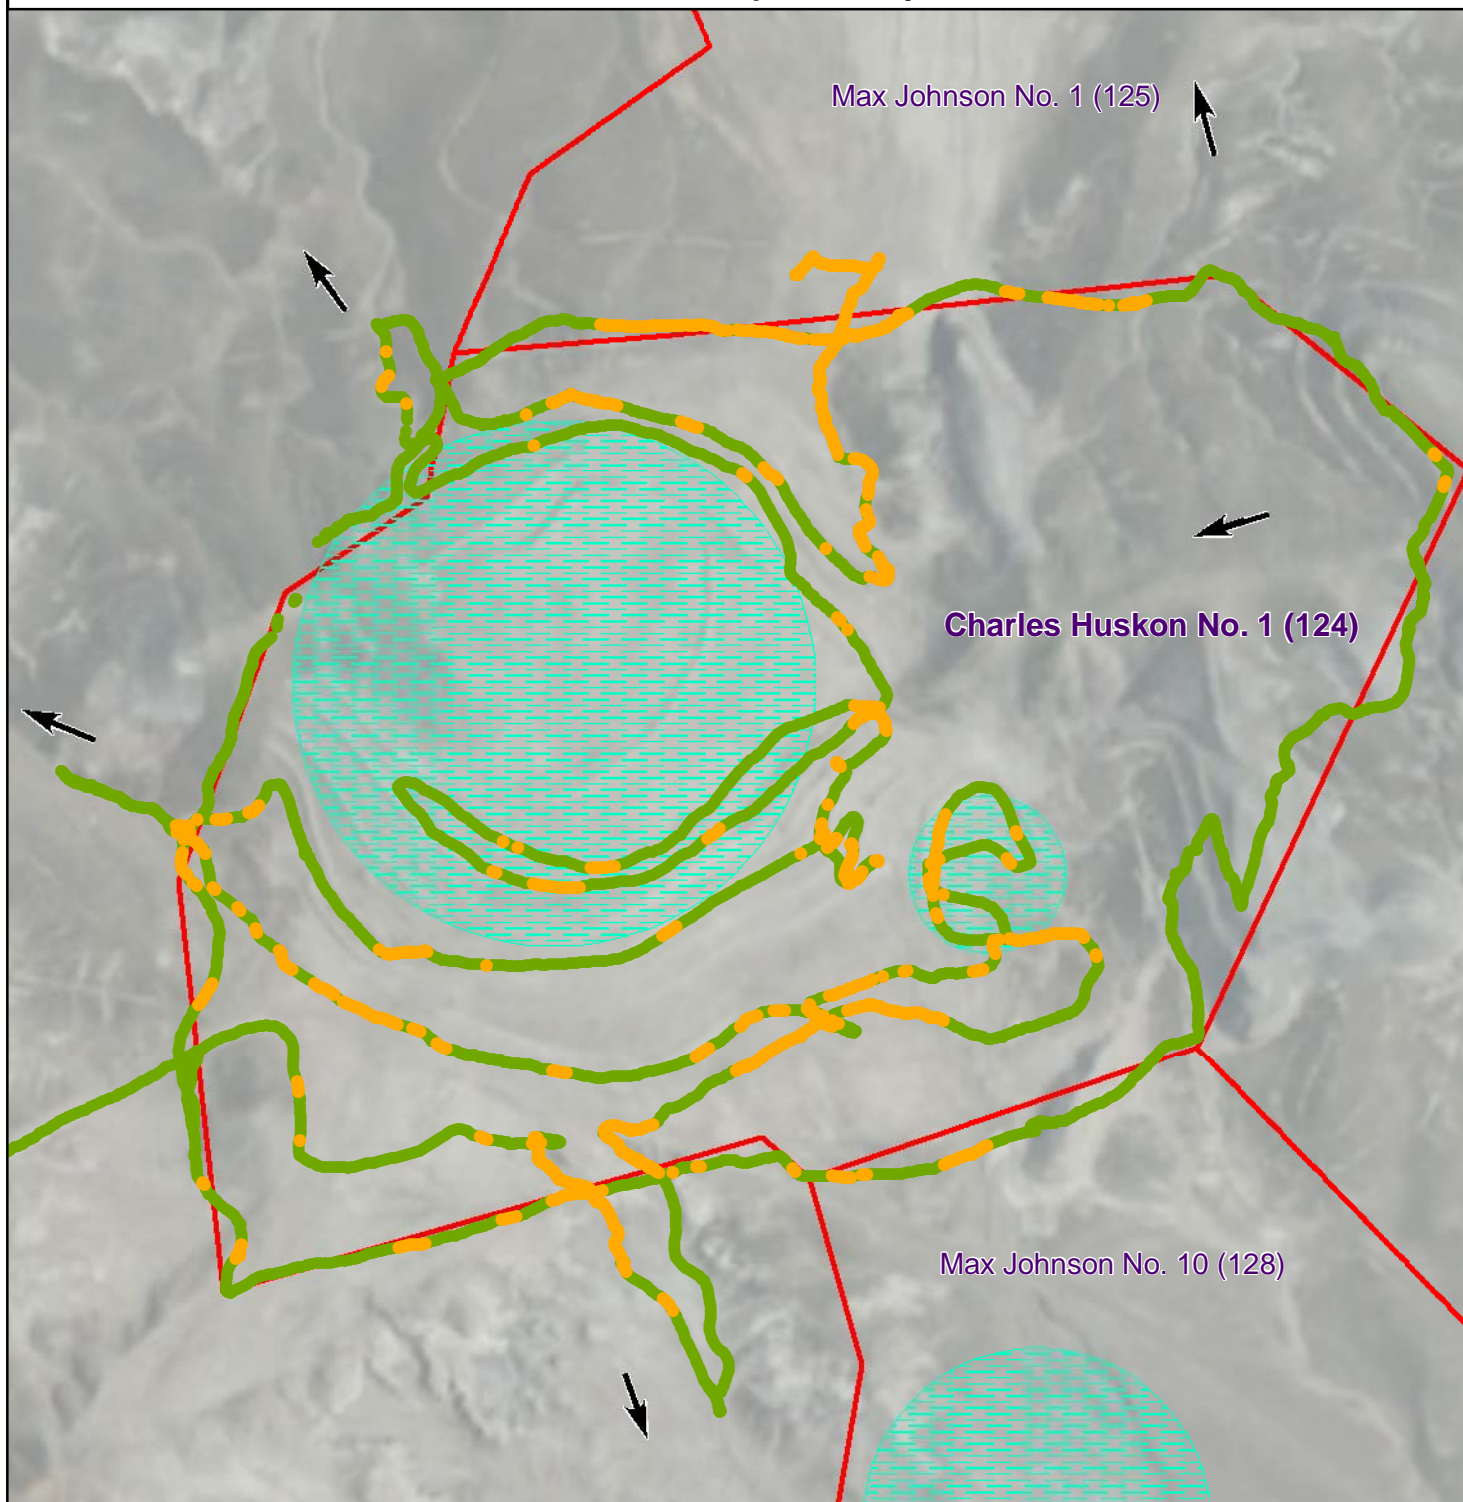

Legend

Gamma Radiation Measurements

- < 2X Background
- > 2X Background

Measured as counts per minute (cpm)

Average background 17,549 cpm

- Mine Site Boundary
- General Slope Direction
- Observed Reclamation Feature
- Observed Waste Pile
- Observed Structure
- Steep Grade




0 250 Feet



WESTON
SOLUTIONS


Figure 2 - Gamma Radiation Measurements
Charles Huskon No. 1 (124)
Coalmine Mesa Chapter, Navajo Nation

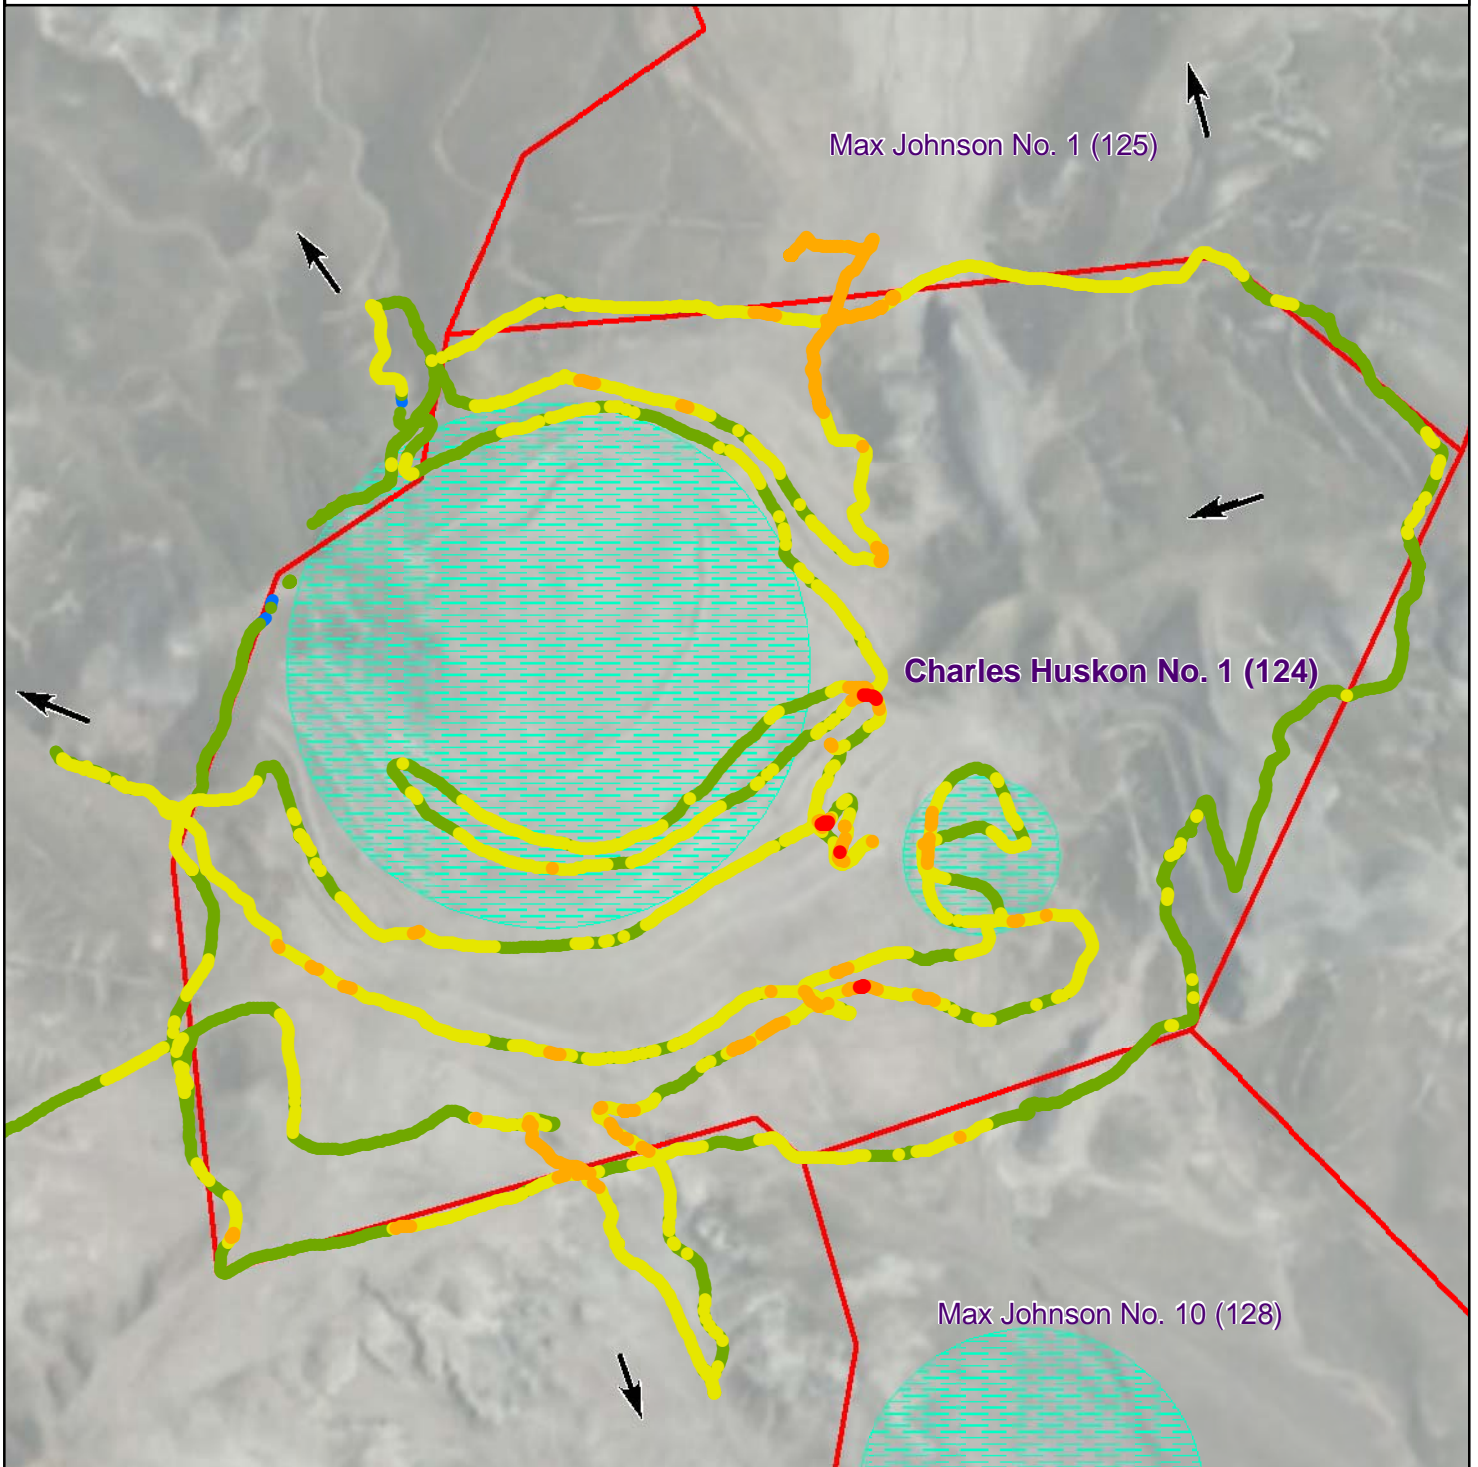

Gamma Radiation Measurements

- 0 - 10,000 cpm
- 10,000 - 25,000 cpm
- 25,000 - 50,000 cpm
- 50,000 - 100,000 cpm
- 100,000 - 250,000 cpm
- 250,000 - 500,000 cpm
- 500,000 - 1,000,000 cpm

- Mine Site Boundary
- General Slope Direction
- ▨ Observed Reclamation Feature
- ▤ Observed Waste Pile
- 🏠 Observed Structure
- ▩ Steep Grade

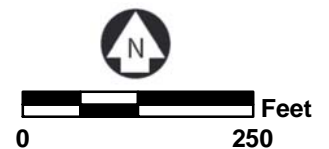

WESTON
SOLUTIONS

Measured as counts per minute (cpm) Average background 17,549 cpm